

Manhole Inspection Summary

Manhole # S09E__013MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **2) Good**

Record Plat: **09E** Node: **013** Status: **Found**

Insp Date: **3/21/08 6:52 AM**

Incomplete Comments

Crew: **CB ET**
Inspector: **Torres**
Firm: **URS**

Location Address: **416 N HILTON ST**

Cross Street: **N/A**

Manhole Type: **Inline** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **Sheeting**

Comments

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **3** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


Steps Count: **5** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View

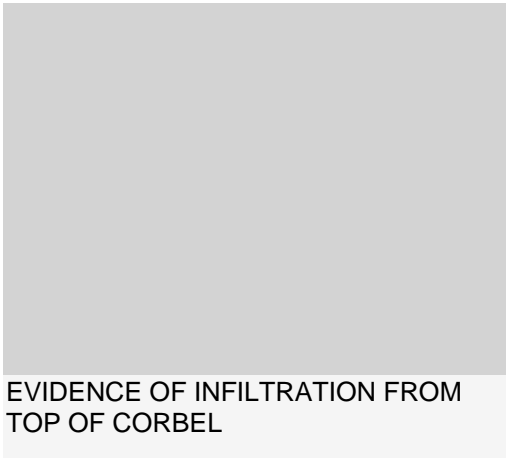

OFFSET



Manhole Inspection Summary

Manhole # S09E__013MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



PIPE DEPOSITS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.70** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☐ Debris ☐ Grease

Silt Depth: **2** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.50** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S09E__013MH

Printed On: 6/24/2010

Page 4 of 4

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.20** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection